

Electric Strike Installation Instruction



Operating Voltage	12VDC,24VDC,12/24VDC
Voltage Tolerance	±15%
Current Draw	0.25A/12VDC 0.15A/24VDC
Operating Temperature	14 – 110 degrees F
Humidity	0-95%



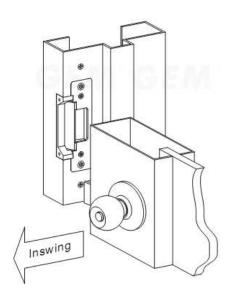

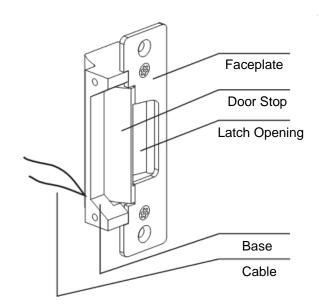

Included Hardware



- 2 x M4x0.7 Screw(s)
- 4 x M5x0.8 Screw(s)
- 2 x 1-1/4 Wood Screw(s)



2 x M4x0.7 Nut(s)




- 2 x Butt Splice Connector(s)
- 2 x Support Bracket(s)


Installation Instructions

- 1. Verify that the strike is in the proper mode of operation (Fail Secure/ Fail Safe). *Refer to page 3*
- **2.** Prepare frame using the appropriate template for your frame type. *Refer to page 2*
- 3. Connect the strike to power source. Refer to page 3
- **4.** Install the strike unit in jamb cutout using the hardware provided. *Refer to page 2*


ANSI Metal Jamb Installations

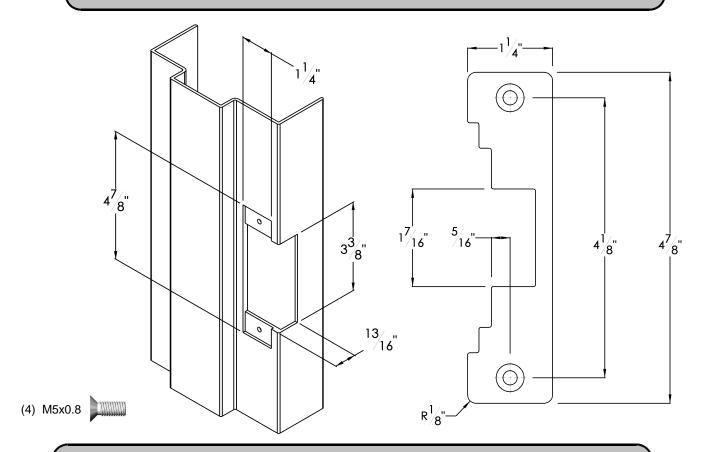

Aluminum Jamb Installations

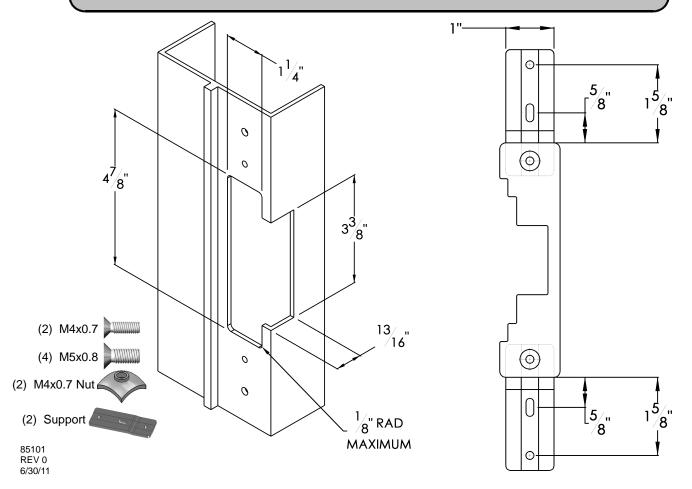


Changing Fail-Safe / Fail-Secure

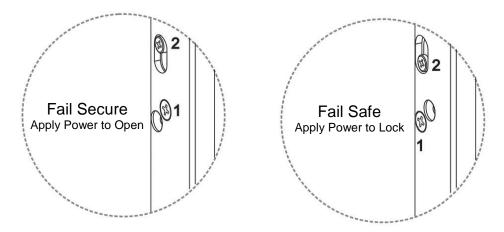

Strike is shipped from factory in fail-secure configuration. If fail-safe configuration is desired, remove screw from hole #1 as shown in above diagram and loosen screw #2. Slide screw #2 to opposite end of the slot and tighten. Install screw #1 into hole labeled fail safe.

Wiring Diagram

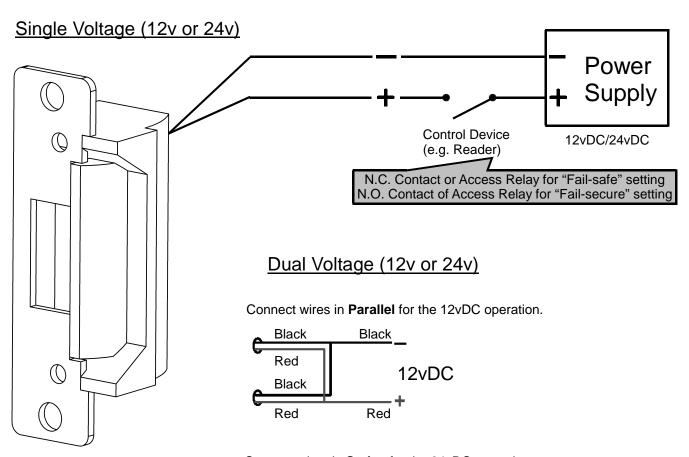

Connect wires in **Series** for the 24vDC operation.

